

Figure 1

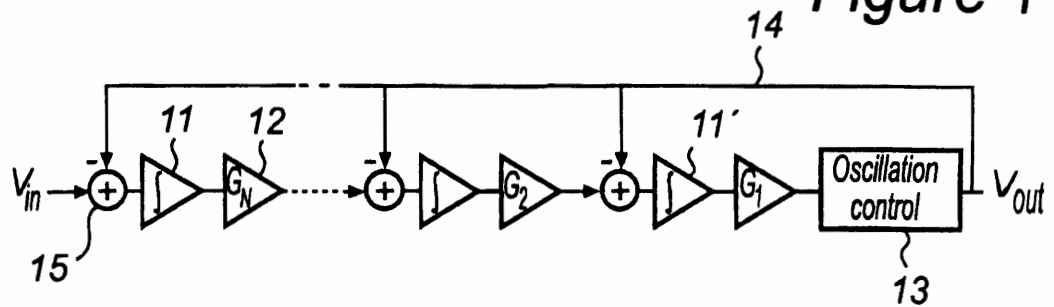


Figure 2

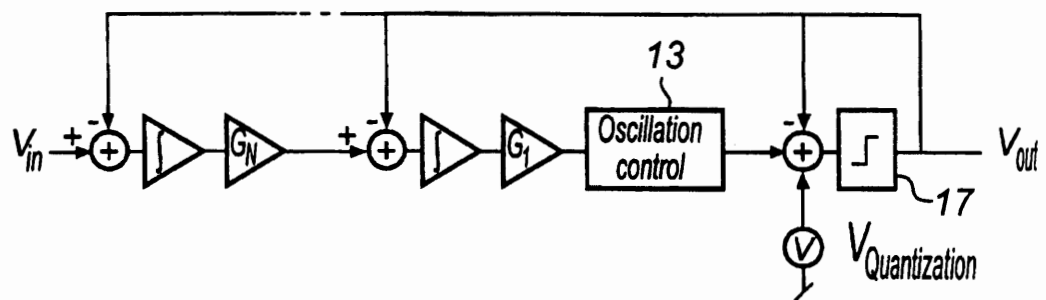


Figure 3

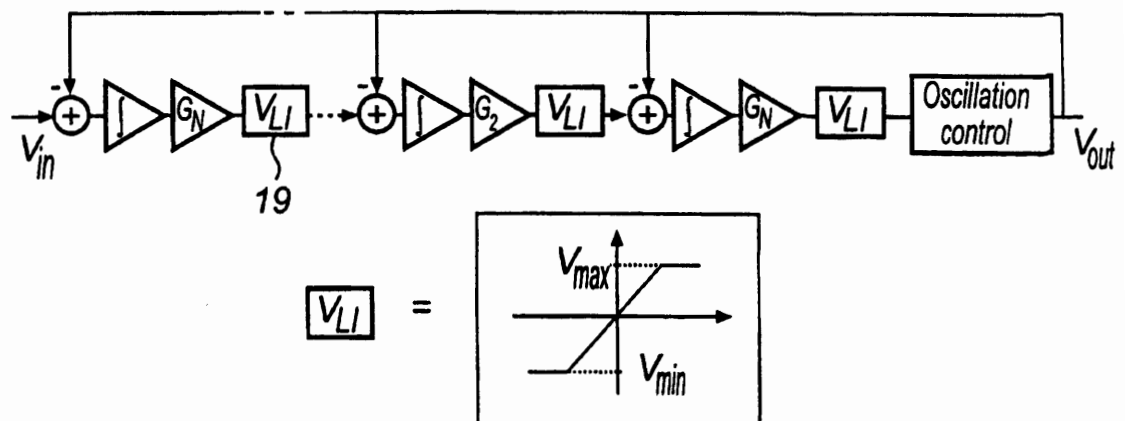


Figure 4

2/4

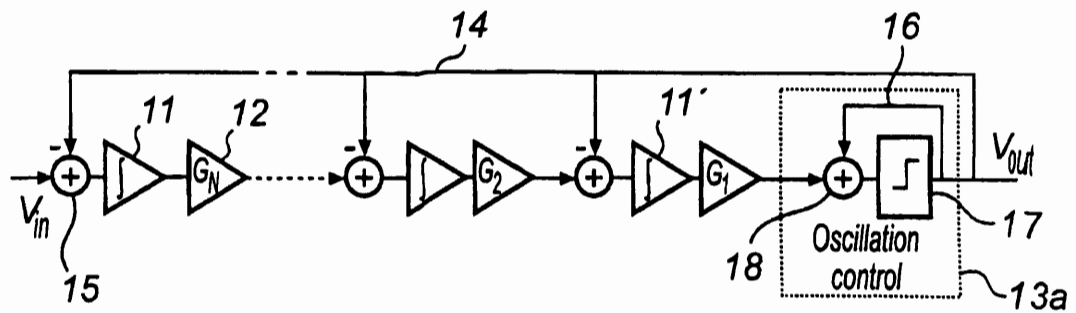


Figure 5

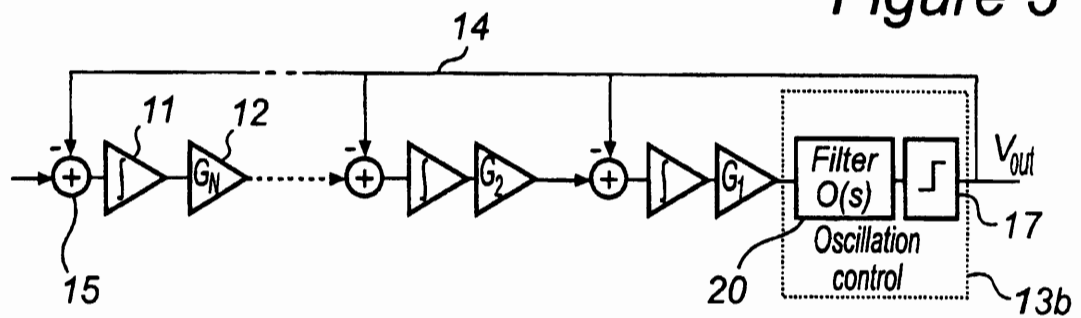


Figure 6

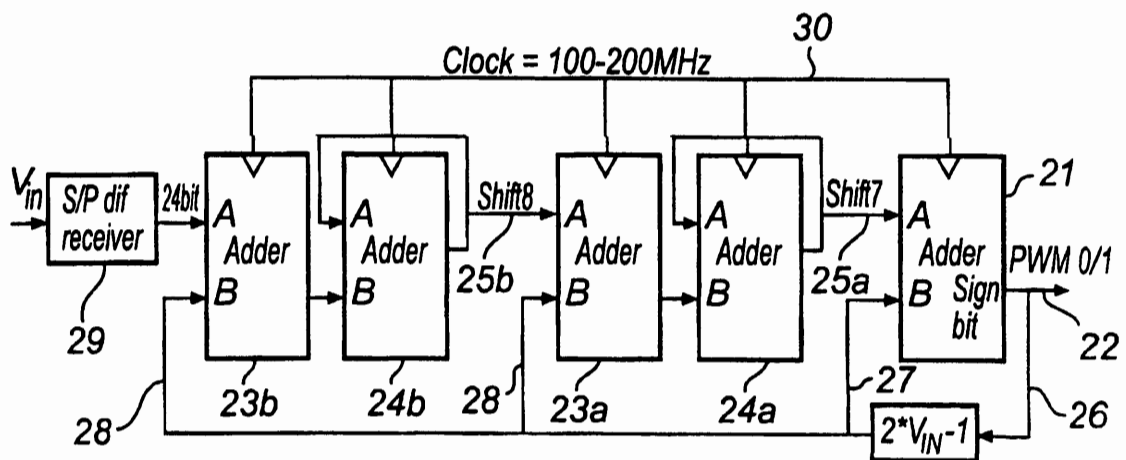


Figure 7

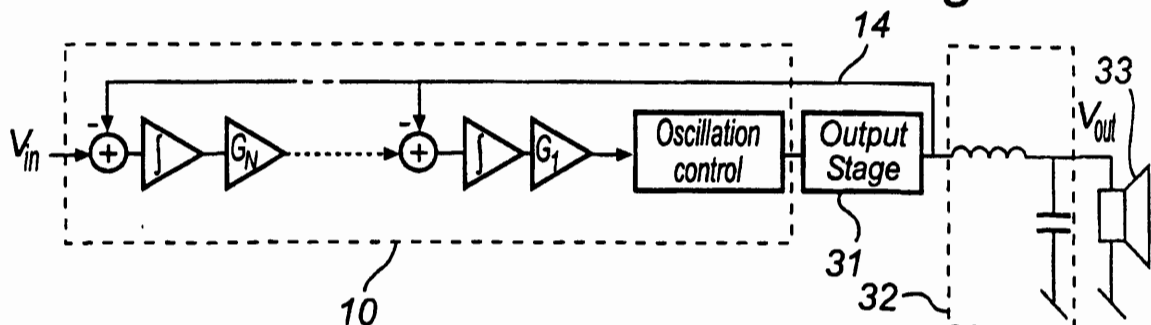


Figure 8

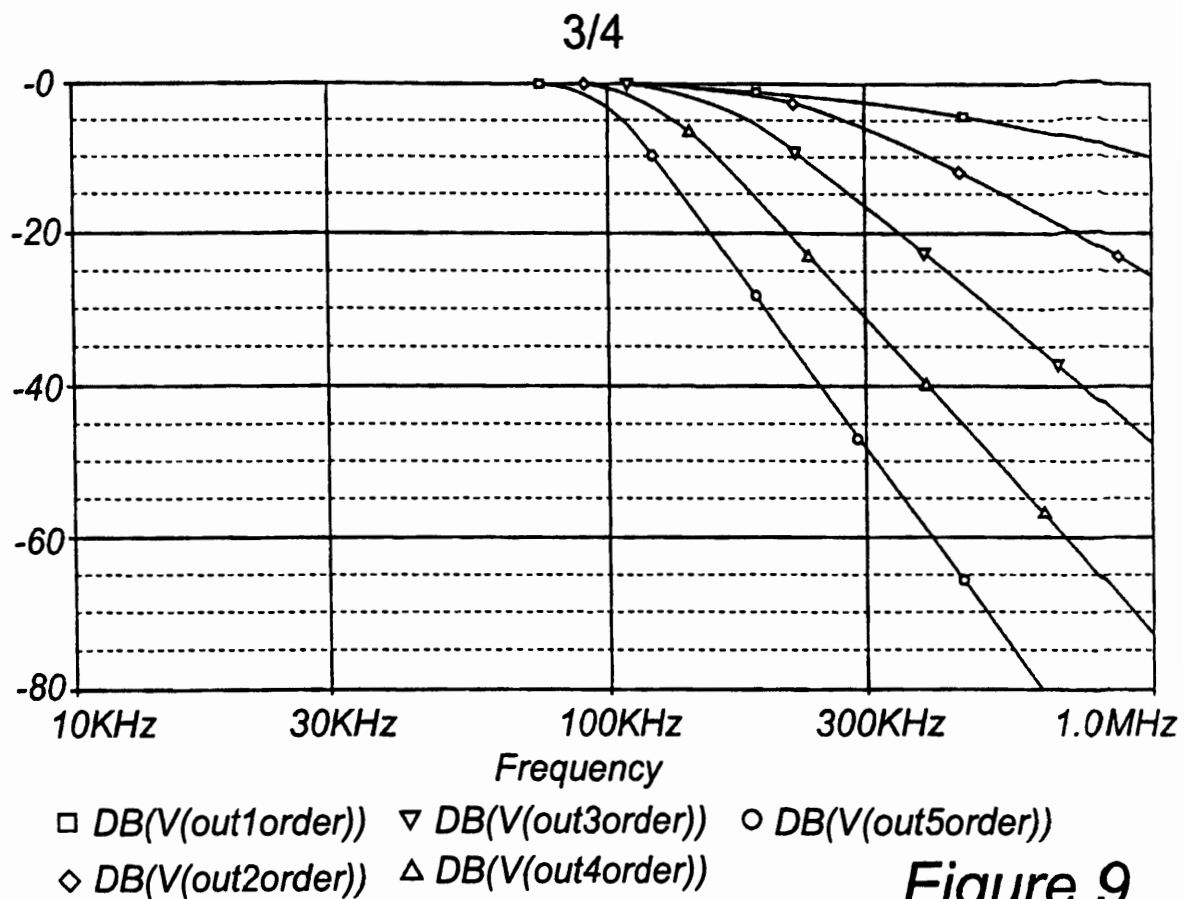


Figure 9

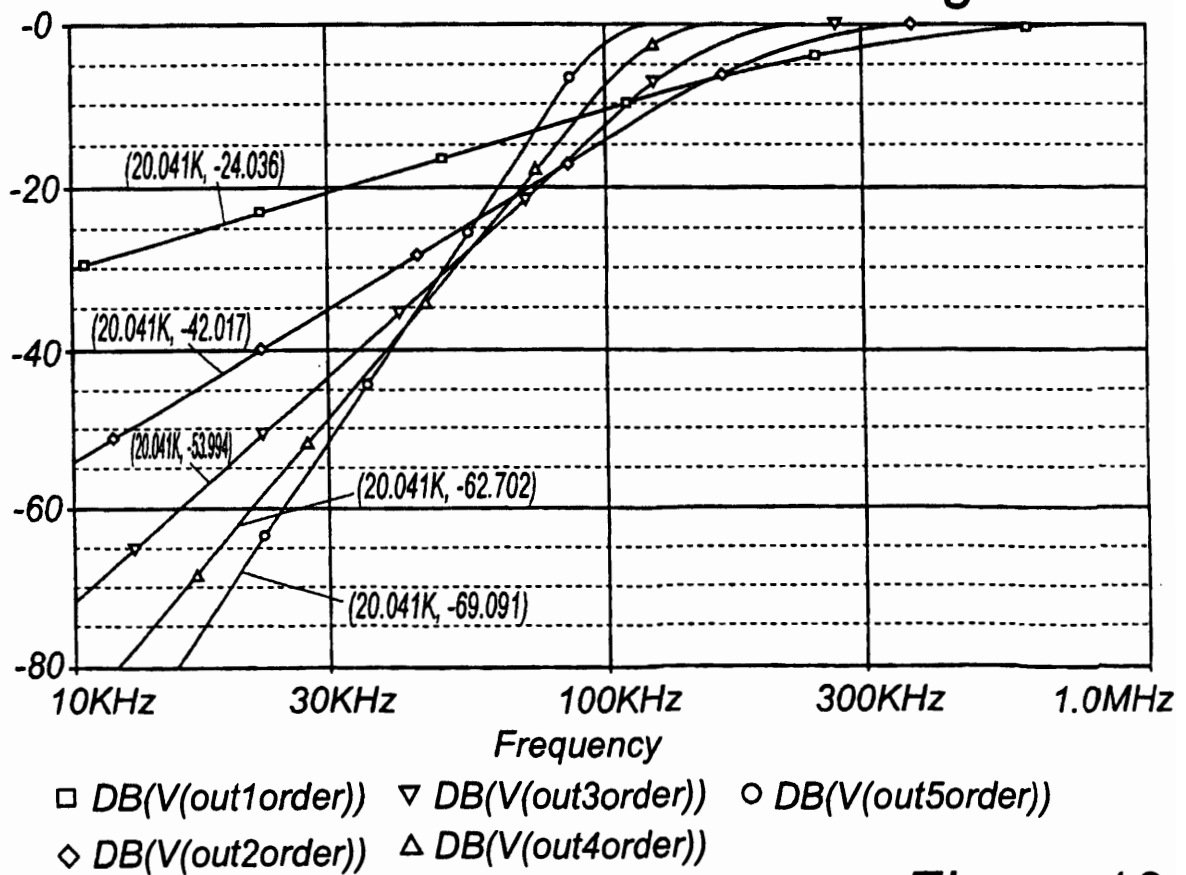


Figure 10

order	k_1	k_2	k_3	k_4	k_5
Butterworth					
1	1	-	-	-	-
2	1	0.50000	-	-	-
3	1	0.50000	0.25000	-	-
4	1	0.50000	0.29292	0.14645	-
5	1	0.50000	0.30901	0.19099	0.095488
Bessel					
1	1	-	-	-	-
2	1	0.33333	-	-	-
3	1	0.41667	0.16667	-	-
4	1	0.45002	0.23333	0.09999	-
5	1	0.46667	0.26667	0.15000	0.066667

Figure 11

order	k_1	k_2	k_3	k_4	k_5
Coefficient ratio in multiples of 2					
3	1	0.25	0.25	-	-
3	1	0.5	0.25	-	-
3	1	1	0.25	-	-
4	1	0.50000	0.50000	0.12500	-
4	1	1	0.50000	0.25000	-
4	1	1	0.25000	0.12500	-
4	1	0.50000	0.25000	0.12500	-
5	1	0.50000	0.25000	0.12500	0.12500
5	1	1	0.25000	0.12500	0.12500

Figure 12